

HASEGAWA ENGINEERING LTD.

CONSULTING PROFESSIONAL ENGINEERS

1224 A - 31 Ave. North

Lethbridge, AB.

T1H 5J8

Office (403) 328 2686

Res. (403) 327 9755

FAX (403) 328 2728

PAGE 1 OF 2


DATE: MAY 22/96


FAX NUMBER: 382 4428

TO: DON WREYSTOCK

MESSAGE:

Attached is the Lab Report
one hole #10 alongside the waterline
service into the Basins Hardware.
The hole was drilled 2' north of the Side
walk as the C.H. power lines were on the
street side

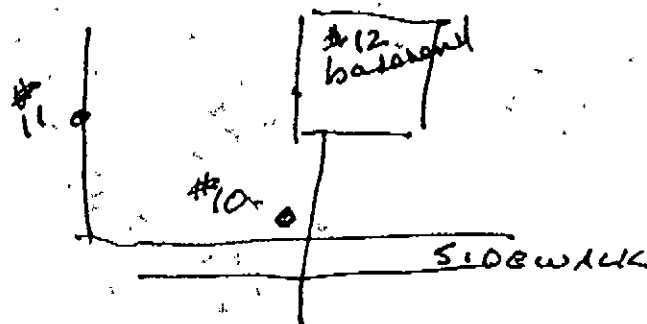

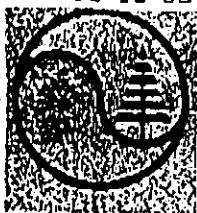**NORWEST
LABS**#6, 2712 - 37 Ave N E.
Calgary, Alberta T1Y 5L3
Phone: (403) 291-2022
Fax: (403) 291-2021TO: Barons Hardware
Hasegawa Engineering Ltd.
ATTN: George M. HasegawaDATE SAMPLED:
DATE RECEIVED: 14-May-96
DATE REPORTED: 21-May-96
LAB FILE#: 96-05-0621

Hardware Site

HYDROCARBON ASSESSMENT - SOIL

LAB #	R1205	R1206	R1207	Detection
CLIENT #	#10	#10	#10	Limit
	5ft	10ft	15ft	
Non-Halogenated Aromatics:				
Benzene	NR	4.52	NR	0.02
Toluene	NR	30.1	NR	0.02
Ethylbenzene	NR	10.4	NR	0.02
Total Xylenes (o, m & p)	NR	69.9	NR	0.02
Total Purgeables (C5-C10)	5.9	682	37.5	0.10

NR = Not Requested

Results expressed in mg/kg dry wt (ppm)

Assessment as per US EPA Method 8020

MAY-22-96 THU 13:29

P. 01

MAY 21 '96 16:53 FR NORWEST LABS

403 291 2021 TO 14033282728

P. 02/04

**NORWEST
LABS**#6, 2712 - 37 Ave N.E.
Calgary, Alberta T1Y 5L3
Phone: (403) 291-2022
Fax: (403) 291-2021TO: Barons Hardware
Hasegawa Engineering Ltd.
ATTN: George M. HasegawaDATE SAMPLED:
DATE RECEIVED: 14-May-96
DATE REPORTED: 21-May-96
LAB FILE#: 96-05-0621

Hardware Site

HYDROCARBON ASSESSMENT - SOIL

LAB #	R1205	R1206	R1207	Detection
CLIENT #	#10	#10	#10	Limit
	5ft	10ft	15ft	
Non-Halogenated Aromatics:				
Benzene	NR	4.52	NR	0.02
Toluene	NR	30.1	NR	0.02
Ethylbenzene	NR	10.4	NR	0.02
Total Xylenes (o, m & p)	NR	69.9	NR	0.02
Total Purgeables (C5-C10)	5.8	682	37.5	0.10

Don Wright stock

NR = Not Requested

Results expressed in mg/kg dry wt (ppm)

Assessment as per US EPA Method 8020

**NORWEST
LABS**

#6, 2712 - 37 Ave. N.E.
Calgary, Alberta T1Y 5L3
Phone: (403) 291-2022
Fax: (403) 291-2021

TO: Barons Hardware
Hasegawa Engineering Ltd.
ATTN: George M. Hasegawa

DATE SAMPLED:
DATE RECEIVED: 14-May-98
DATE REPORTED: 21-May-96
LAB FILE#: 86-05-0621

Hardware Site

Page 2

HYDROCARBON ASSESSMENT - SOIL

LAB #	R1208	R1209	R1210	R1211	Detection
CLIENT #	#11	#11	#11	#12	Limit
	5ft	10ft	18ft	3ft	
Non-Halogenated Aromatics:					
Benzene	NR	<0.02	NR	<0.02	0.02
Toluene	NR	<0.02	NR	<0.02	0.02
Ethylbenzene	NR	<0.02	NR	<0.02	0.02
Total Xylenes (o, m & p)	NR	<0.02	NR	<0.02	0.02
Total Purgeables (C5-C10)	0.3	<0.1	<0.1	<0.1	0.10


T. Ahlstrom
Supervisor - Organics

NR = Not Requested

Results expressed in mg/kg dry wt. (ppm)

Assessment as per US EPA Method 8020

